

# Coil Winder

**A Tesla Coil winding machine, controlled by Mios:**

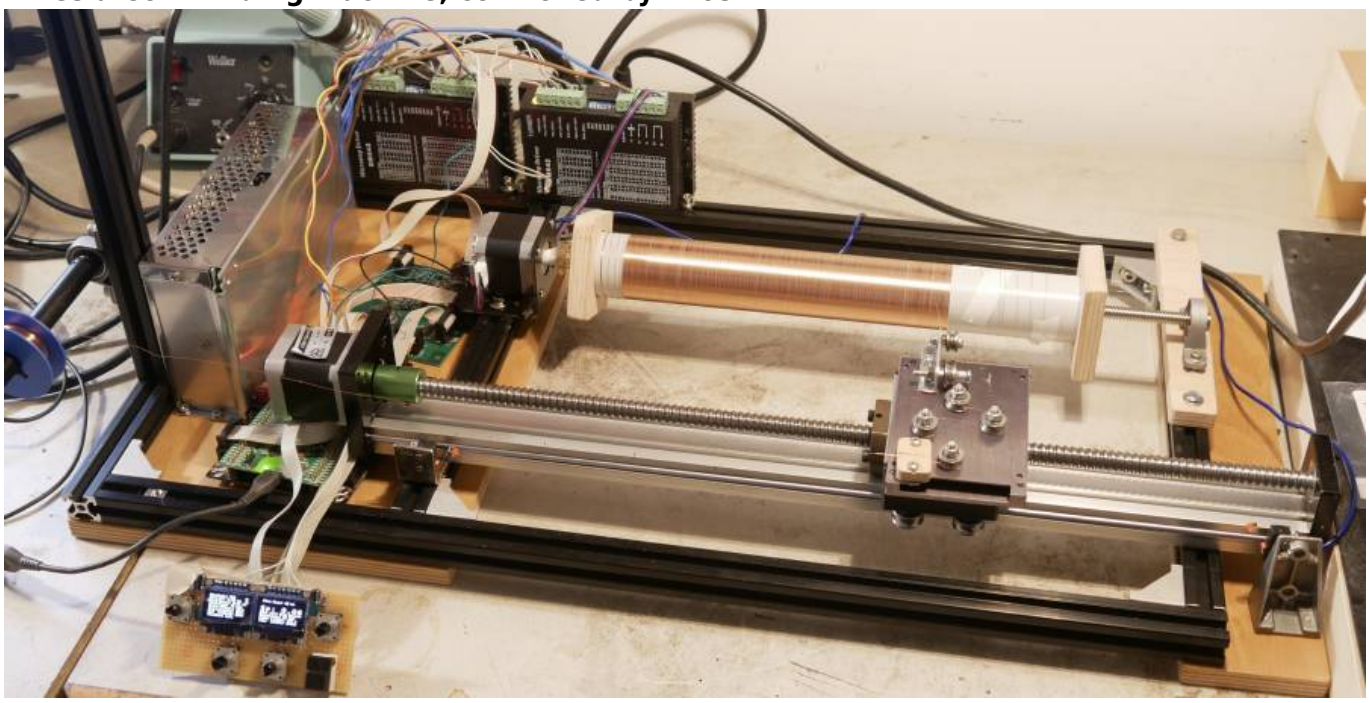

Watch German Video about using it, and TimeLapse build (English will come in future...):

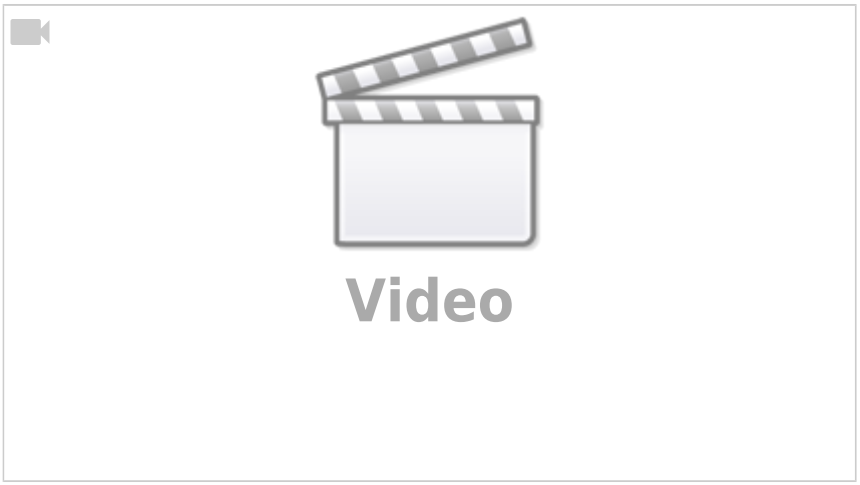


## CODE, FIRMWARE

**Install MIOS Studio, connect a Core-Stm32F4 via USB, and Start the STUDIO**

**1. Upload MIOS BOOTLOADER**
**2. (only needet for Virgin Machines) type following commands into the MIOS-TERMINAL:**


- set lcd_type GLCD_SSD1306_ROTATED
- set lcd_num_x 2
- set lcd_num_y 1

- set lcd_width 128
- set lcd_height 64
- store

**3. Unzip the Firmware, and Upload the project.hex**
**4. Unconnect USB & Connect the USB again — finished.**
**5. If the Machine is not detected by mios studio, and you already checked the usb-connections, the device or the code is broken, for that you may search for “Bootload Switch”, please set it to “bLOAD”, now you can upload new & unbroken codes, dont forget to set it to “normal” back again - after upload new code - else the APP will not boot…**

# BUILD

## Shemata

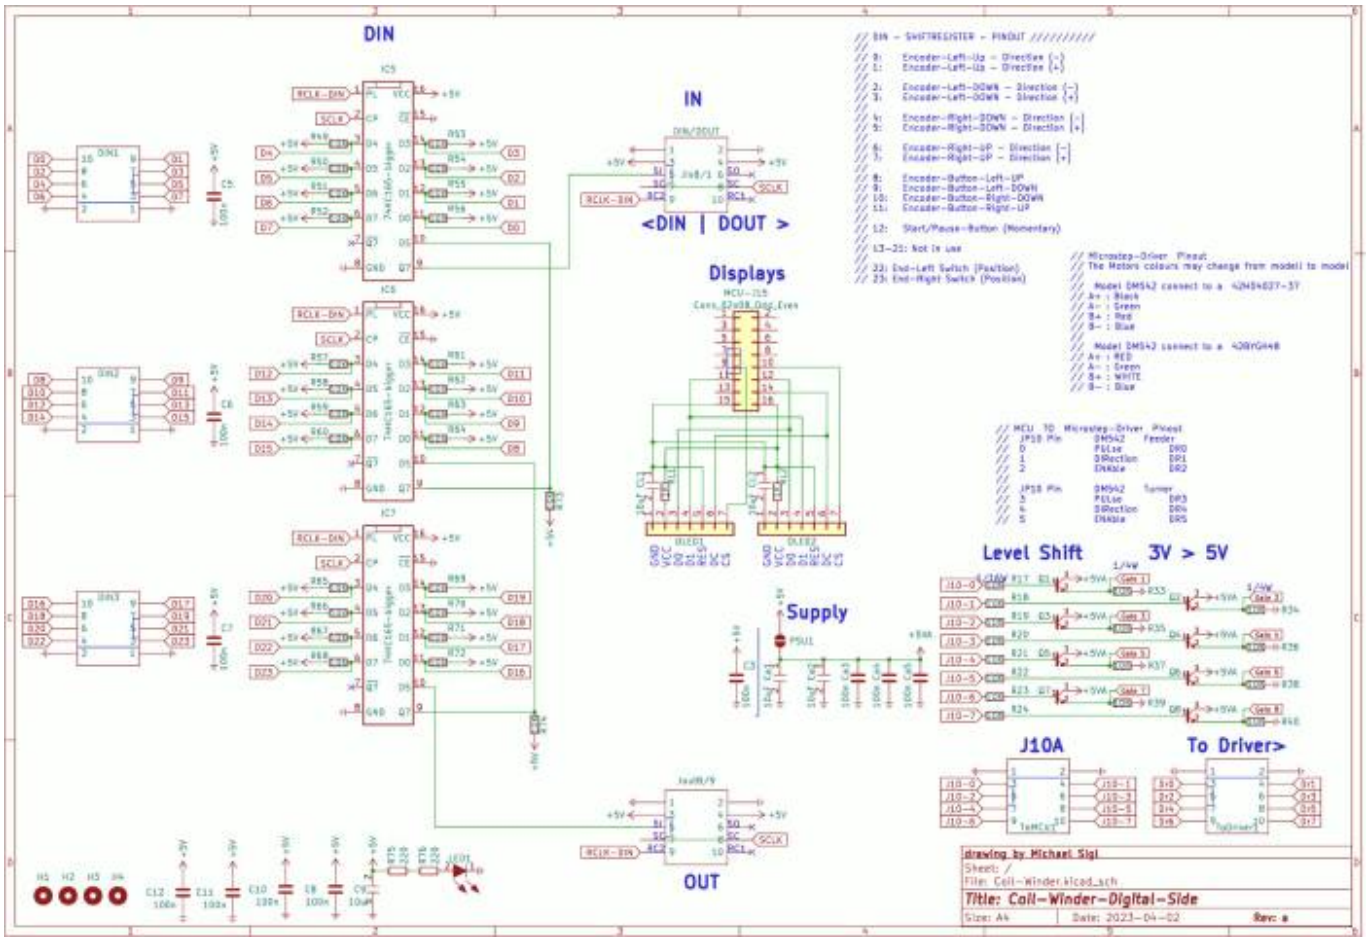


The Rest is stated in the youtube video, in TimeLapse
You can use any motor you like, the code is programmed for a Motor that takes 400 steps for a whole 360° turn… if you use other motors you need to adapt the code (which you can download a bit above…)

## Main Parts

**Midibox**: Core STM32 based core (STM32F4)

DINX4 Module (only 3DINX are used)
Levelshifter circuit from 3to5Vs (J10A to Motor-Driver)
2x SSD1306 Screens with 64×128 Pixels - 7Pin Variant!!!
4x Encoders with inbuilt switches
1x Momentary Button for “Play/Pause”
1x Breathboard ca. 100x50mm
3 days time

There are a lot of wires, nuts and screw which i have not listed here, here are only the big and expensive parts:

**Amazon/Ebay/Ali...**
Turner Motor: Iverntech NEMA 17 Schrittmotor mit integrierter 400 mm T8-Leitspindel I dont think that is a good choice, the T8 Spindle bends to much... better you M10-M12 ones and 450mm or more Travel
*Feeder Motor: Akozon Linearschiene - this hasent come in good condition, the first 5cm moove a bit woobly*
Corner-Mounts: Justech 10x Winkelverbinder Aluprofil 20x20mm better order 2 sets...
*20x20mm Profiles: CNCYEAH 4 Stück 800mm Aluminiumprofil20X20 T*
Stepper Motor Driver: DM542 Schrittmotor Controller you need 2 off them!

PSU: Schaltnetzteil 24V 10A

Mounting Kit for the Turner-Motor: 42 mm Schrittmotor-Halterung not the stabelst one... mooves under Load...find better...

Microswitches: Mikroschalter Endschalter mit Rollenhebel 250V 5A SPDT 1NO 1NC you need 2 off them


V-Rolls for Wires: V624ZZ Kugellager V Nut Rillenkugellager you will need 6 off them and special M4 Screws else they will not moove

T8 Nuts: T8 Mutter Gewindespindel Messing Mutter you need 3 off them, but you may find a better way to mount your pipe on the Spindle!


Flange Bearing: Flanschlager you need 2 off it...

# Menue Structure


Menue 1: Load and Save Coil-Data

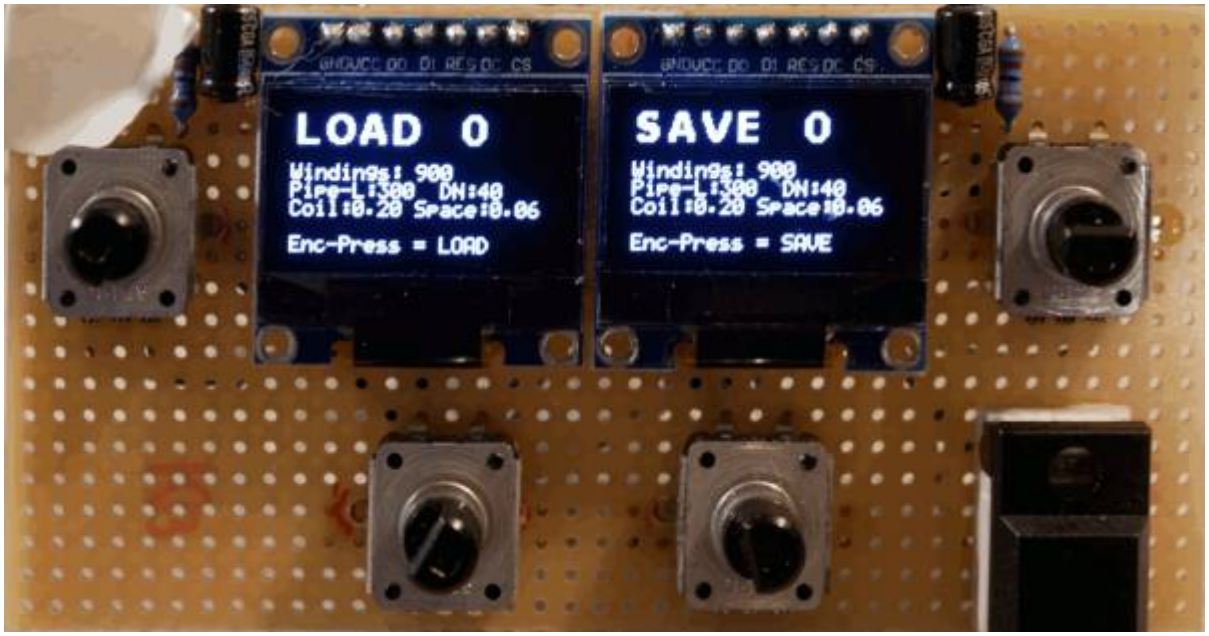



*Menue 2: Edit Coil-Data, and get some resulting values*

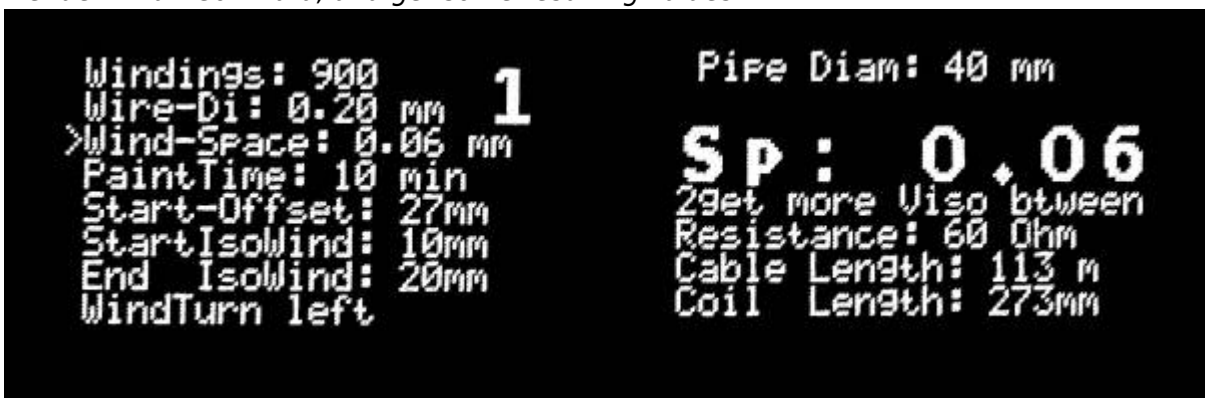


Menue 3: Start the Operation, guide thru Stages

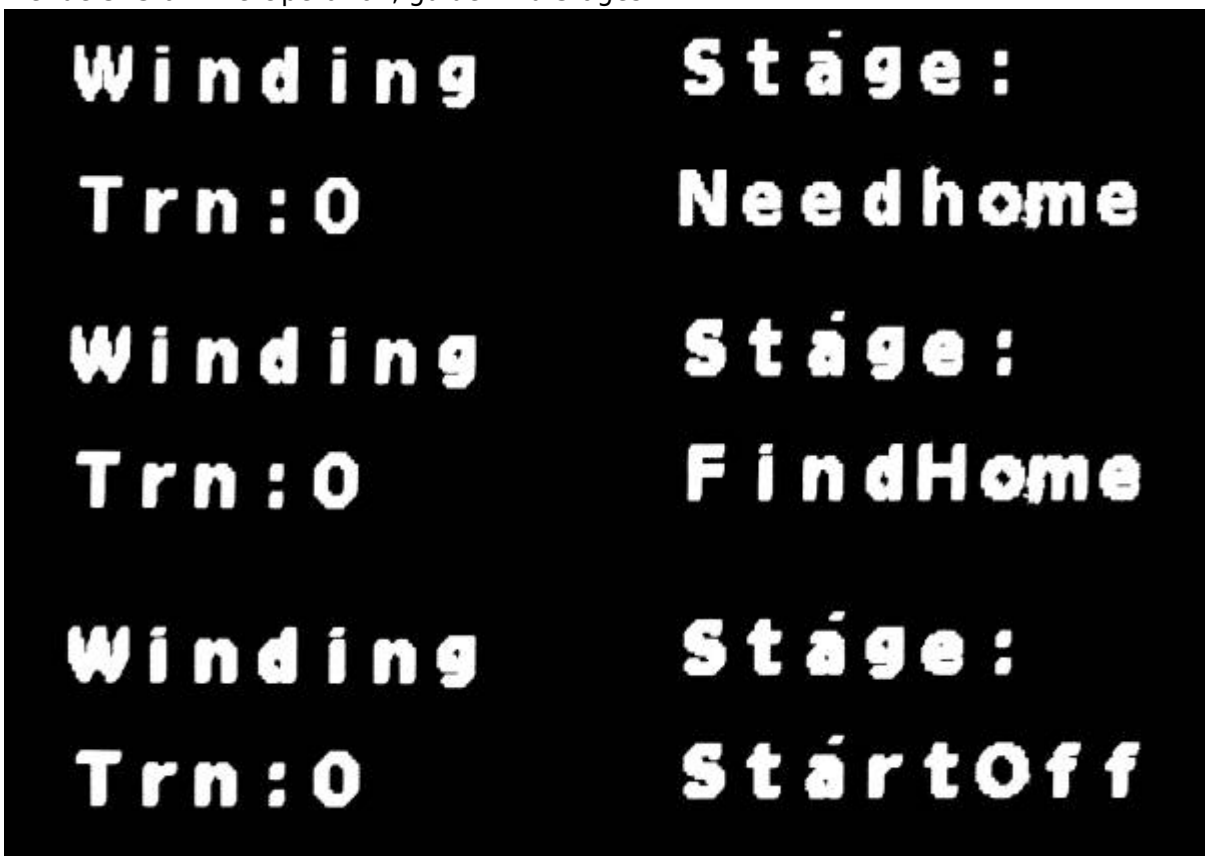

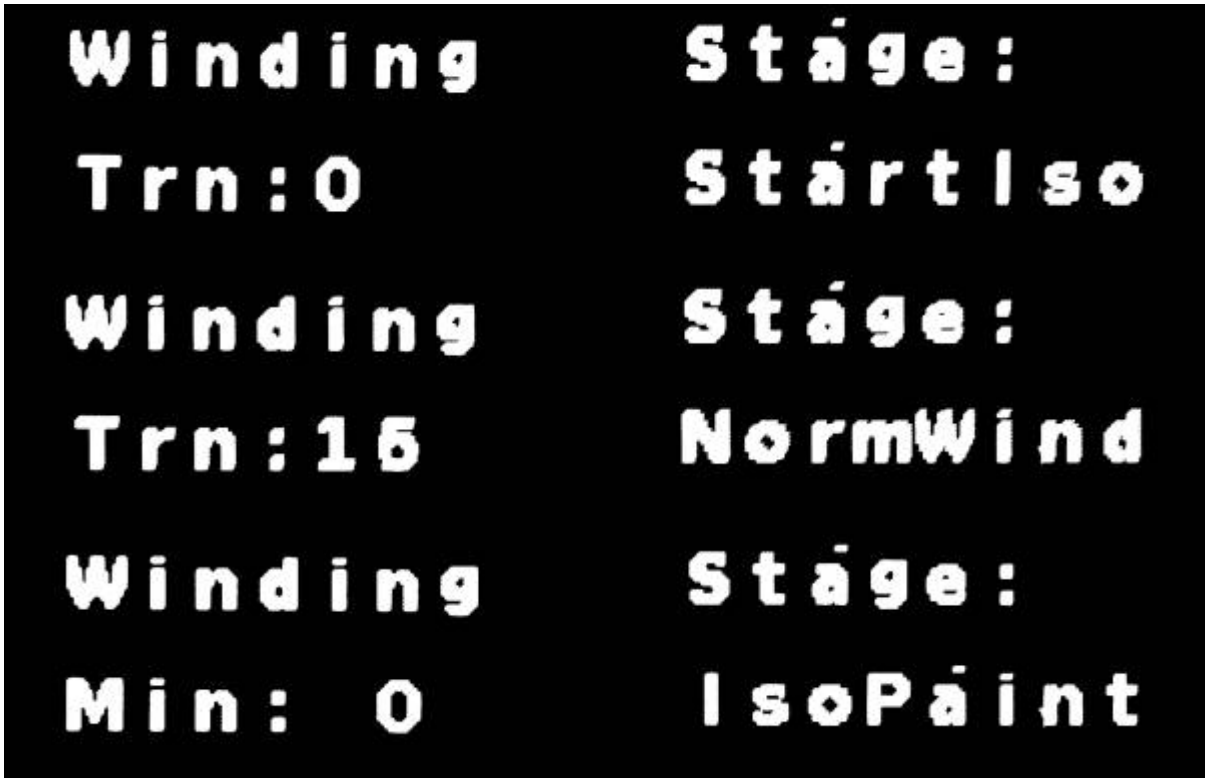


## Community users working on it

- **Phatline** = Programming, Documentation, Hardware-Prototype, Testing, Winding

## Getting Involved ?

Just let a Private message on the forum to user already involved

From:
https://midibox.org/dokuwiki/ - **MIDIbox**

Permanent link:
**https://midibox.org/dokuwiki/doku.php?id=coilwinder&rev=1680469358**

Last update: **2023/04/02 21:02**